

CBS1004803 Derating with Heat Sink (H=0.25inch)

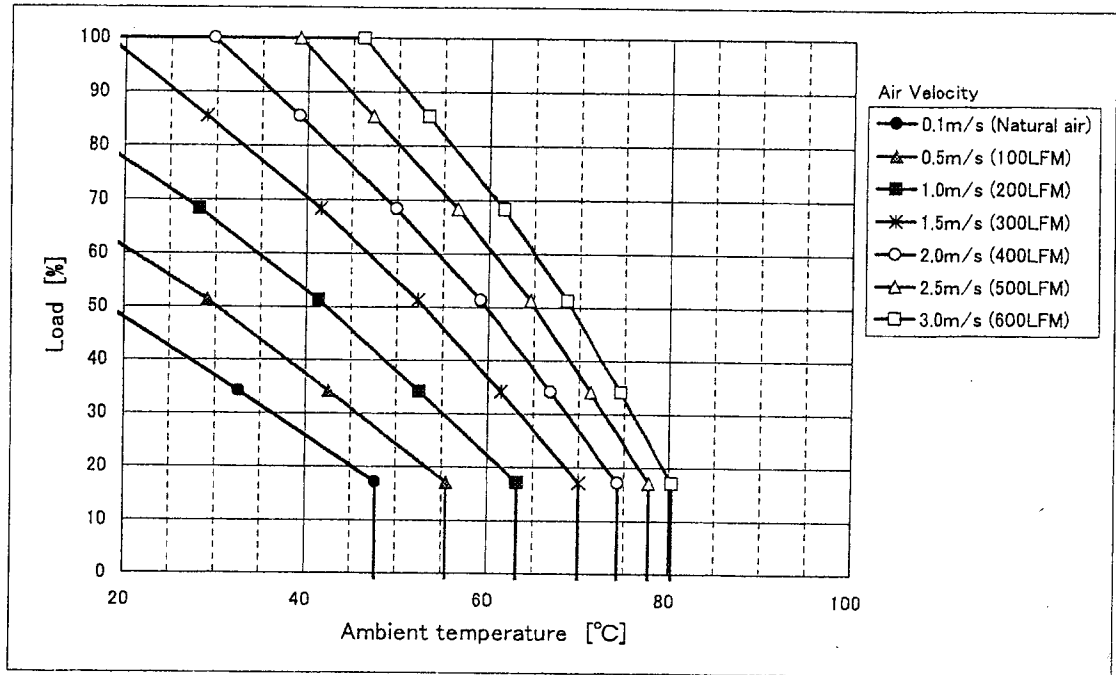


Fig. 1 CBS1004803 Derating (H=0.25inch)

※ 1 m/sec ≅ 200 LFM (linear feet per minute)

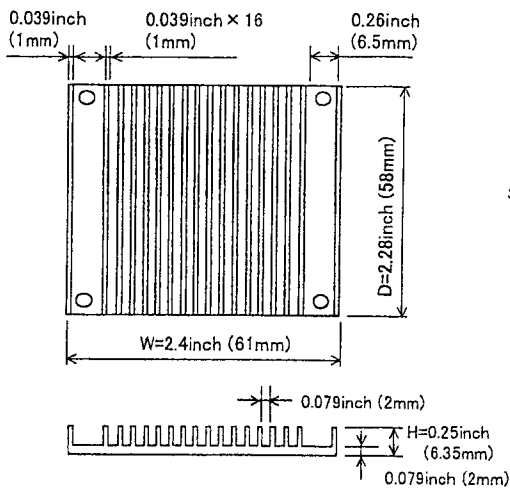


Fig.2 Size of Heat Sink

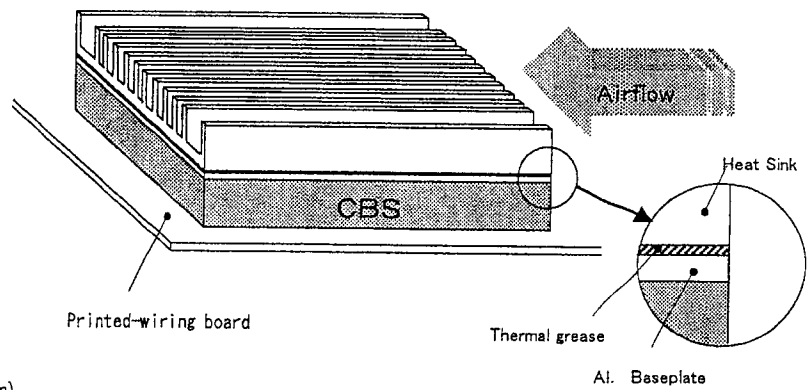


Fig.3 Test method

Note: Verify that baseplate temperature is below design level.

CBS1004803 Derating with Heat Sink (H=0.5inch)

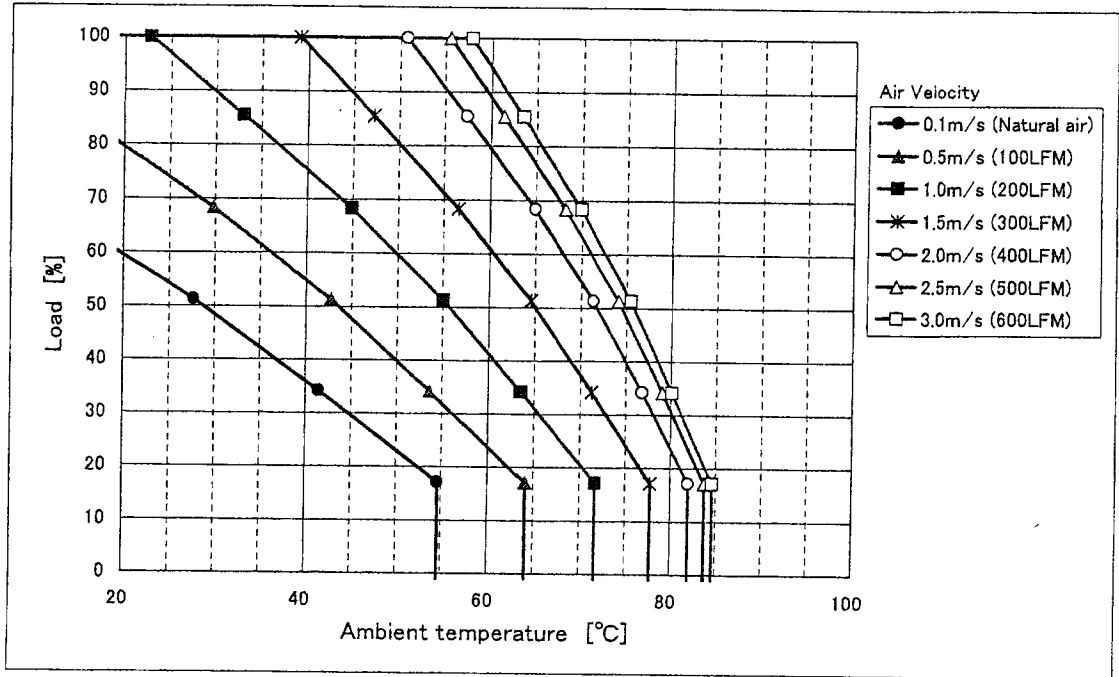


Fig. 1 CBS1004803 Derating (H=0.5inch)

※ 1 m/sec ≙ 200 LFM (linear feet per minute)

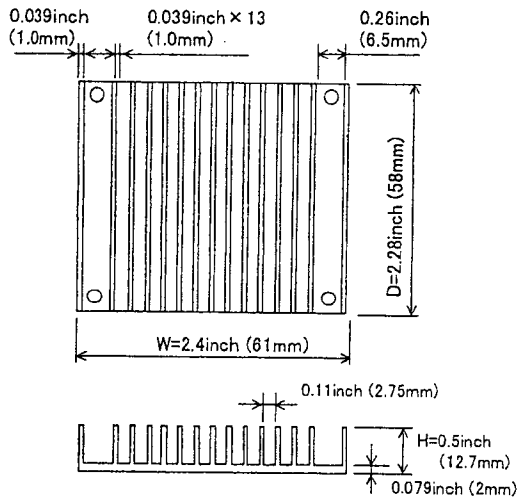


Fig. 2 Size of Heat Sink

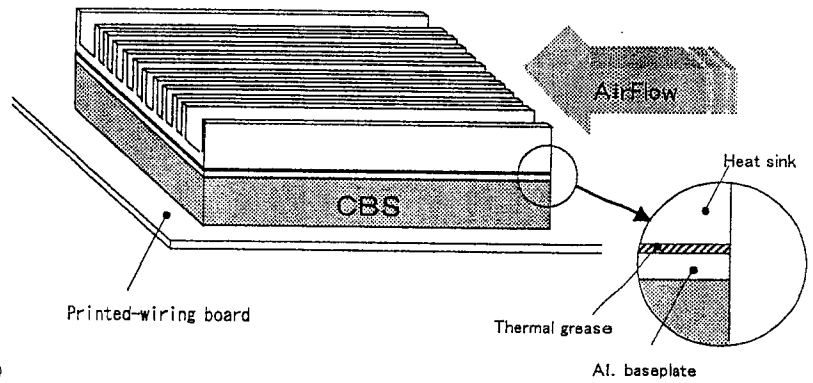


Fig. 3 Test method

Note: Verify that baseplate temperature is below design level.

CBS1004803 Derating with Heat Sink (H=1.0inch)

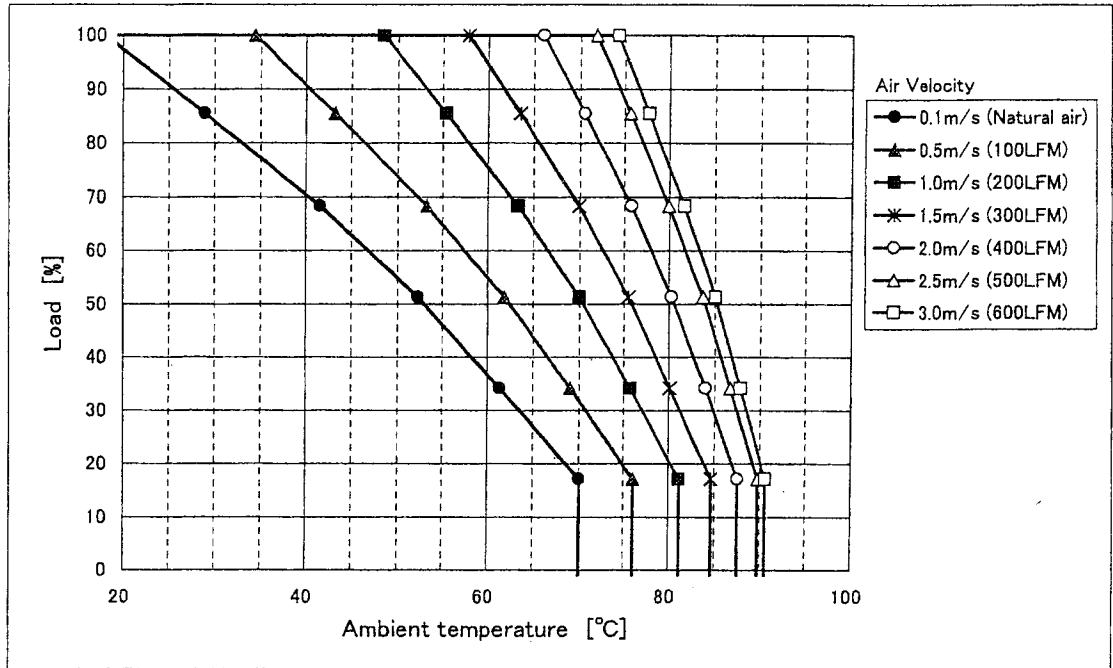


Fig. 1 CBS1004803 Derating (H=1.0inch)

※ 1 m/sec ≅ 200 LFM (linear feet per minute)

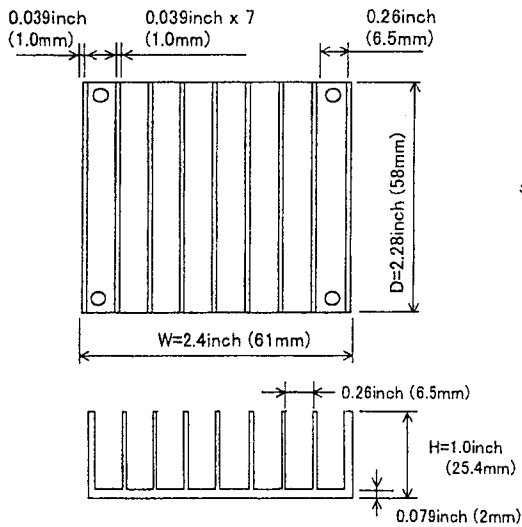


Fig.2 Size of Heat Sink

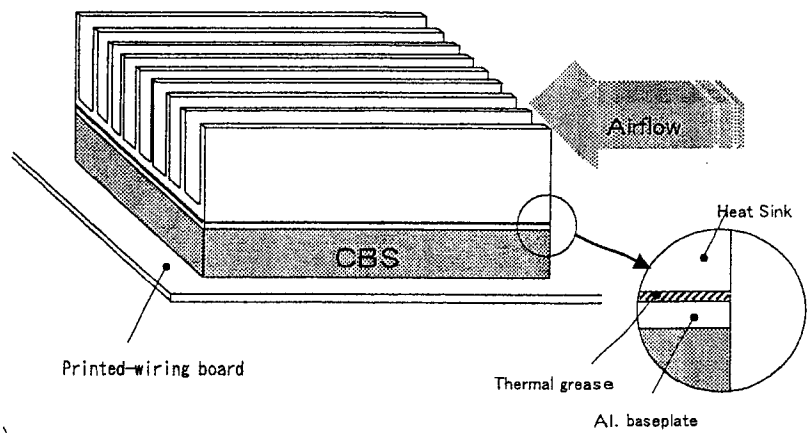


Fig.3 Test method

Note: Verify that baseplate temperature is below design level.

CBS1004803 Derating with Heat Sink (H=1.5inch)

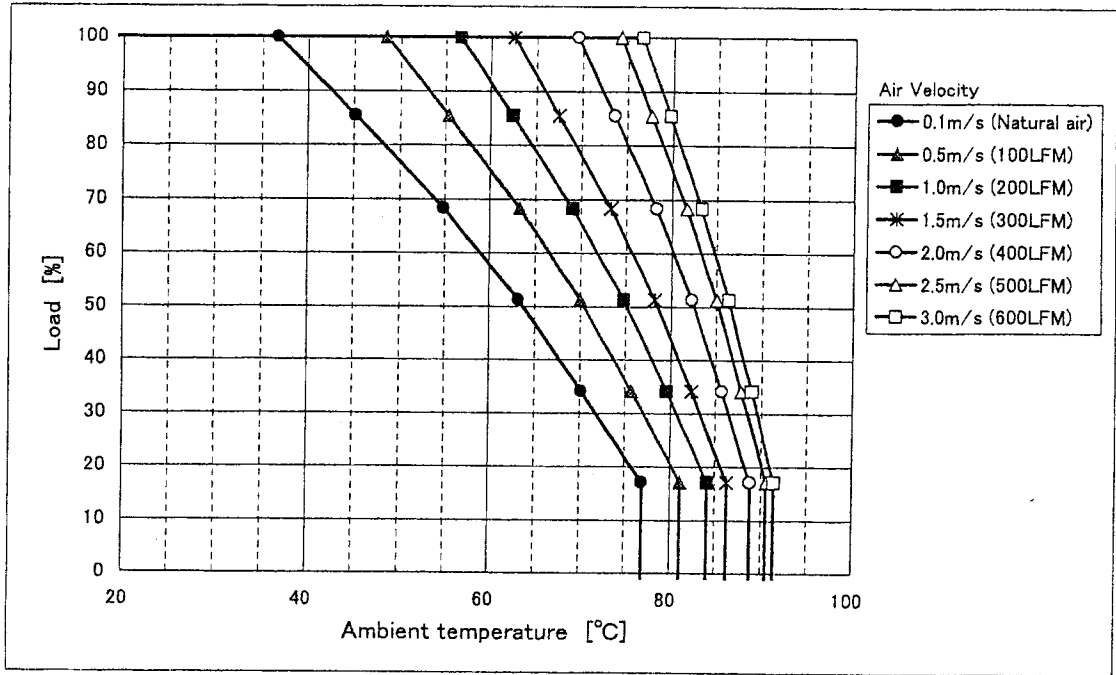


Fig. 1 CBS1004803 Derating (H=1.5inch)

※ 1 m/sec ≅ 200 LFM (linear feet per minute)

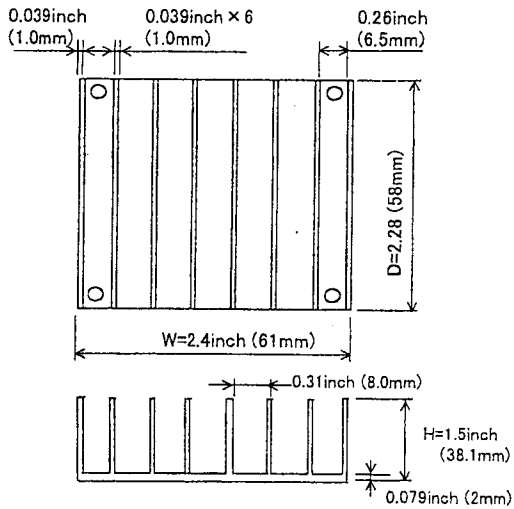


Fig.2 Size of Heat Sink

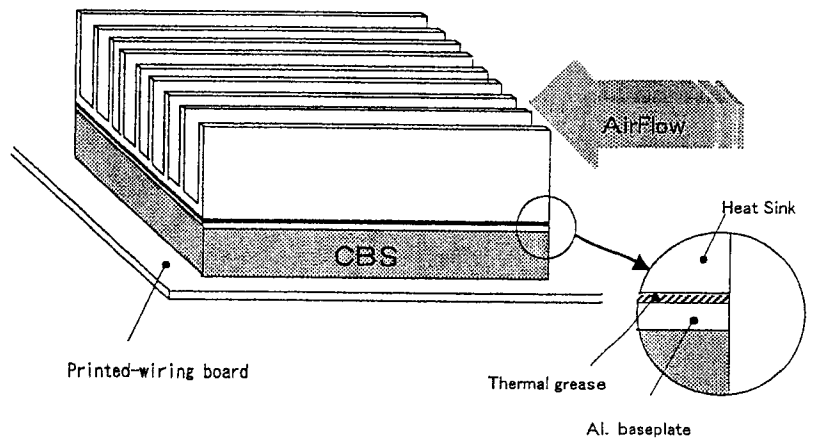


Fig.3 Test method

Note: Verify that baseplate temperature is below design level.